



U.S. Department of Transportation

National Highway Traffic Safety Administration

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



Case Vehicle (A): 2000 Land Rover Type: Discovery II, 4-door SUV

Driver: 32-year-old male CDC: 12-FYEW-3

SITUATION

(Slide 1) Case vehicle (A) was traveling in the eastbound lane of a straight section of a snowy, dirt roadway, (slides 2, 3) with a speed limit of 89 kph (55 mph). The driver of case vehicle (A) had two days experience driving the vehicle. Case vehicle (A) began to fishtail to the left. The driver tried to correct for the yaw, but lost control of case vehicle (A) as it began to fishtail to the right. Case vehicle (A) went off the left side of the road and struck a tree, entered a counterclockwise rotation, crossed the road, and came to rest on the right shoulder facing south.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 4) Damage to case vehicle (A) was severe. The direct-damage length was 45 cm and began 50 cm inboard from the left-front bumper corner. The maximum crush was 68 cm and occurred 95 cm inboard from the left-front bumper corner. The left wheelbase was reduced 10 cm, and the right wheelbase was increased 9 cm.

Using the WinSMASH accident-reconstruction program and (slides 5, 6, 7, 8, 9) c-values for case vehicle (A), the following impact severity was calculated:

| | | Calculated Velocity Change - kph (mph) | | | |
|------------------|----------|--|--------------|-------------|--|
| Vehicle | Variable | Total | Longitudinal | Latitudinal | |
| Case Vehicle (A) | delta V | 48 (30) | -47 (-29) | 8 (5) | |

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slides 10, 11, 12, 13) The front bumper, both headlight assemblies, grille, and both fenders were damaged. The hood was crushed, the hood latch was damaged and jammed, and both hood hinges were damaged. The rear edge of the hood was elevated, and it contacted and cracked the windshield, but did not penetrate it. The windshield was cracked by the stress of impact forces and by hood contact. The left-upper A-pillar was slightly deformed and the left-front door was jammed closed.

Interior

(Slides 14, 15, 16, 17, 18) This vehicle was equipped with both steering-wheel and passenger frontal-impact airbags, which deployed during the frontal impact. No damage was noted to the airbag skins or (slides 19, 20, 21, 22, 23, 24, 25, 26) to the module doors/flaps. This vehicle also is equipped with pretensioners, which fired during the frontal impact, as indicated by (slide 27) a comparison of the latch assembly from the case vehicle with (slide 28) that of an exemplar vehicle. (Slide 29) The steering-wheel rim was not deformed, and there was minor lateral rotation of the steering column to the left. (Slide 30) The following intrusion was noted and measured:

| Location | Component | Distance (cm) | Direction |
|------------|---|---------------|-----------|
| left front | toepan below right side knee bolster strike | 14 | rearward |

(Slides 31, 32, 33, 34, 35) The left-front side window shattered, the foot controls, middle instrument panel, and center console were damaged. (Slide 36, 37) The driver-side knee bolster, a center control knob, and the glovebox door were also damaged by occupant contact.

OCCUPANT INJURIES AND KINEMATICS

(Slides 38, 39) The 6-ft, 4-in, 180-lb, 32-year-old male driver was reportedly wearing the available three-point belt, the steering-wheel airbag deployed, and the pretensioner fired. On impact, he moved forward into the belt restraints and the deployed airbag. He sustained a contusion to the left shoulder from loading by the shoulder belt webbing. (Slides 40, 41, 42, 43) The knee bolster to the right of the steering column and the vertical console were cracked and dented, and an air-vent control knob was damaged, but no injuries were reported that could be associated with these apparent contact points.

(Slides 44, 45, 46) The 5-ft, 5-in, 140-lb, 29-year-old female was reportedly wearing the available three-point belt, the frontal-impact passenger airbag deployed, and the pretensioner fired. On impact she moved forward into the belt restraints and the deployed airbag. She sustained fractures to the distal right 2nd and 3rd metacarpals, probably from the airbag flinging her hand into the interior side surface of the vehicle. She also sustained contusions to the left and right hip from loading by the lap belt. The glovebox door was damaged, but no injuries were reported that could be associated with this apparent contact point.

The following tables and (slides 47, 48) attached drawings summarize the injuries sustained by the driver and the right front passenger.

Occupant: Driver Restraints: 3-point belt worn; airbag deployed

Age: 32 years Stature: 193 cm (6 ft, 4 in)

Sex: Male Mass: 82 kg (180 lb)

| Maximum A.I.S. Level Injury Severity Score A.I.S. Definite Probable Possible Shoulder belt webbing A.I.S. Definite Probable Possible Possible | | | Injury Source | | | |
|---|----------------------------|--------|-----------------------|----------|----------|--|
| Maximum A.I.S. Level 1 | Injury Description | A.I.S. | Definite | Probable | Possible | |
| | Contusion, left shoulder | 1 | Shoulder belt webbing | | | |
| | | | | | | |
| | | | | | | |
| | | | | ' | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | Maximum A I S Level | , | | | | |
| Injury Severity Score 1 | A COMMINGENERAL CONTRACTOR | + | | | | |
| | Injury Severity Score | 1 1 | | | | |
| | | - | | | | |

Occupant: Right front Restraints: 3-point belt worn; airbag deployed

Age: 29 years Stature: 165 cm (5 ft, 5 in)


Sex: Female Mass: 64 kg (140 lb)

| | | Injury Source | | |
|---|----------|------------------|----------|--------------------------------------|
| Injury Description Fractures, impacted distal right 2 nd and 3 rd metacarpals | A.I.S. | Definite | Probable | Possible |
| Fractures, impacted distal right 2 nd and 3 nd metacarpals | 2 | | | Interior side surface – airbag fling |
| Contusion, left hip | 1 | Lap belt webbing | | |
| Contusion, right hip | 1 | Lap belt webbing | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| | | | | |
| Maximum A.I.S. Level | 2 | | | |
| Injury Severity Score | <u>5</u> | | | |

| Duplicate columns 1-8 Module G I Format 0 from the previous card. 9 10 11 | 2 12 | GENERAL INFORMATION | GI-1 |
|---|--|---|---------------|
| TIME DATE OF COLLISION | _ | ENVIRONMENTAL CONDITIONS CONSTRUCTION ZONE (0) NO (1) YES (9) UNKNOWN ROAD ALIGNMENT VERTICAL PLANE (1) LEVEL (2) CREST OF HILL (3) SLOPE (2%) (4) BOTTOM OF HILL (9) UNKNOWN ROAD ALIGNMENT HORIZONTAL PLANE (1) STRAIGHT (2) CURVE (3) T - SHAPED (4) Y - SHAPED (7) OTHER: (9) UNKNOWN | 33 1 34 |
| ENVIRONMENTAL CONDITIONS LIMITED-ACCESS HIGHWAY (0) NO (1) YES (9) UNKNOWN ROAD, TOTAL TRAFFIC LANES (FOR CASE VEHICLE) (1) 1-LANE (2) 2-LANES (3) 3-LANES (4) 4 OR MORE LANES (5) DIVIDED, 4 OR MORE LANES (6) PARKING LOT/DRIVEWAY (7) OTHER: (9) UNKNOWN INTERSECTING RD, TOTAL LANES CHOOSE FROM ABOVE LIST, OR (8) NOT APPLICABLE TYPE OF ROAD SURFACE (1) ASPHALT (2) CONCRETE (3) GRAVEL (4) MORE THAN ONE (CIRCLE EACH) (7) OTHER: (9) UNKNOWN ROAD DEFECTS (0) NO (1) YES (9) UNKNOWN | Q_{28} Q_{28} Q_{30} Q_{31} Q_{32} | (10) DRY (21) WATER - DAMP (22) WATER - WET (23) WATER - PUDDLED (29) WATER - AMOUNT UNKNOWN (31) SNOW - LOOSE (32) SNOW - PACKED (39) SNOW - CONDITION UNKNOWN (41) ICE (51) SLUSH (61) SPILLED GRAVEL (71) OTHER: (99) UNKNOWN VISIBILITY LIMITATION (FOR CASE VEHICLE) (0) NONE (1) CLOUDY/DARK (2) FOG (3) SMOKE (4) WINDSHIELD CONDITION (5) GLARE (6) RAIN (7) OTHER: (8) ICE/SNOW (9) UNKNOWN VISIBILITY OBSTRUCTION (FOR CASE VEHICLE) (0) NONE (1) BUILDING (2) SIGN (3) VEGETATION (E.G. BUSHES, SHRUBS) (4) TREE (5) HILL OR CURVE IN ROAD (6) VEHICLE IN TRANSPORT (7) OTHER: (8) PARKED VEHICLE | 36 37 |

| | | GENERAL INFORMATION | GI-3 |
|---|--------------|--|----------------|
| CRASH DETAILS CASE VEHICLE AND OBJECT (0) NO (1) YES (9) UNKNOWN CASE VEHICLE ROLLOVER (0) NO ROLLOVER (1) YES, FIRST EVENT (2) YES, SUBSEQUENT EVENT (3) YES, SEQUENCE UNKNOWN | 1 47 Q | HIGHEST POLICE INJURY SEVERITY CODE IN CRASH (NOT JUST CASE VEHICLE) (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT (7) NON-FATAL INJURY SEVERITY UNKNOWN (9) UNKNOWN | 2 55 |
| (9) UNKNOWN CASE VEHICLE RAN OFF ROADWAY (BEFORE FIRST IMPACT) (0) NO (1) YES (9) UNKNOWN MOVING CASE VEHICLE AND CONTACTED MOVING VEHICLE | 149 | DRIVER ALCOHOL INVOLVEMENT (CASE VEHICLE) (0) NONE (1) YES (9) UNKNOWN/NOT REPORTED/ NO DRIVER DRIVER ALCOHOL BAC | <u></u> |
| (0) NO (1) YES (9) UNKNOWN CASE VEHICLE AND CONTACTED STOPPED VEHICLE (0) NO (1) YES (9) UNKNOWN | 50 | (CASE VEHICLE) (80) NO TEST (90) CHEMICAL TESTS, NO RESULTS (95) AUTOPSY, NO RESULTS (99) UNKNOWN WAS THERE MENTION OF DRIVER IMPAIRMENT FOR CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | - 8 D 57 58 |
| STOPPED CASE VEHICLE AND CONTACTED VEHICLE (0) NO (1) YES (9) UNKNOWN | 52 | LIST IMPAIRMENTS MENTION | NED: |
| TOTAL NUMBER OF VEHICLES CONTACTED BY CASE VEHICLE IN CRASH (8) 8 OR MORE (9) UNKNOWN ANY FIRE IN THIS CRASH (NOT JUST CASE VEHICLE) (0) NO (1) YES (9) UNKNOWN | <u>53</u> | POST - CRASH DETAIL MANNER CASE VEHICLE LEFT SCENE (1) DRIVEN (2) TOWED DUE TO DAMAGE (3) TOWED, NOT DUE TO DAMAGE (4) TOWED, REASON UNKNOWN (9) UNKNOWN | 80 |

| ACCIDENT DESCRIPTION: (ase vehicle (A) was traveling in the eastbound CASE VEHICLE (A): 2000 Land Pover 7 | Discovery |
|---|-----------|
| lane of a straigh section of a snowy, dirt roadway. The driver OTHER VEHICLE (B): N/A | 7 |
| of Case vehicle (A) had two day exporience driving the vehicle THIRD VEHICLE (C): N/A | |
| Case vehicle (A) began to fishtail to the left. The driver tried to correct the yaw but lost | |
| control of case vehicle (A) as it began to fish tail to the right. Case vehicle (A) chove off the left | |
| Side of the road and Struck a tree, enforced a clockwise votation, crossed the road, and come to nest | |
| on the right shoulder facing south. | NORTH |

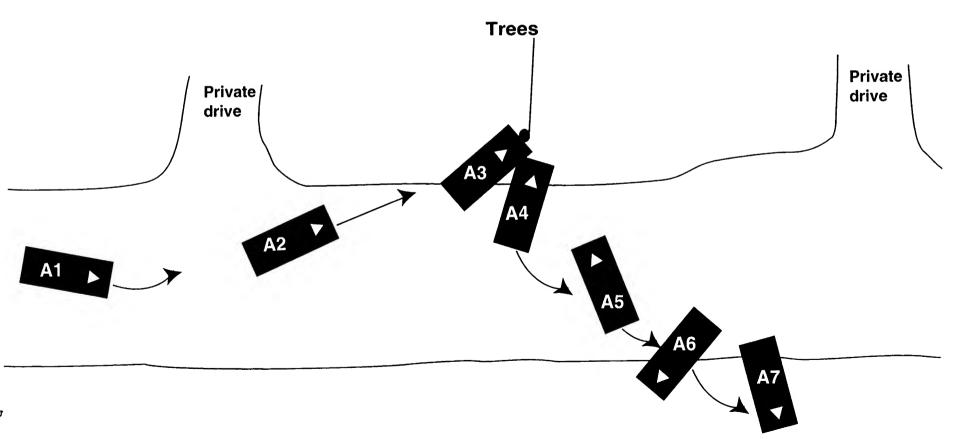

| Duplicate columns 1-8 from the previous card. Module O V Format 0 11 | 12 | | OTHER VEHICLE | ΟV |
|---|-----|--|---|----|
| MAKE: | | | CARGO: | |
| MODEL: | | | | |
| 13 | | | 29 | 1 |
| MANUFAC/BODY CODE | 34 | | LE TYPE | |
| MAKE/MODEL CODE N | 38 | (02) (03) (17) (20) (24) (25) (26) | IGER VEHICLE LARGE LIMOUSINE PICKUP CAR UNKNOWN PASSENGER VEHICLE BODY SUB-MINI MINI SUB-COMPACT | 56 |
| VEHICLE MASS (kg) | 48 | (28) | COMPACT INTERMEDIATE FULL | |
| IF SEPARATE REPORT WAS MADE, GIVE VEHICLE NUMBER | | (14) (15) | URPOSE PASSENGER VEHICLE SMALL UTILITY (WHEELBASE LESS THAN 107", E.G. JEEP, BRONCO) LARGE UTILITY (WHEELBASE MORE THAN 107", E.G. PANEL TRUCK, SUBURBAN) PICKUP TRUCK WITH CANOPY/SHELL COVER | |
| NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) | 51 | (17) (21) (22) (23) | PICKUP TRUCK WITH CANOPY/SHELL COVER MOTOR HOME PICKUP TRUCK WITH SLIDE-IN CAMPER PICKUP CAR WITH SLIDE-IN CAMPER CHASSIS-MOUNTED CAMPER | |
| TRAVELING SPEED (km/h) | | TRUCK | | |
| (000) PARKED OR STOPPED (995) JUST STARTING UP (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) (998) SPEED EXCESSIVE (BUT UNKNOWN) (999) UNKNOWN | gv. | (11) (12) (13) (15) (16) (22) (30) (31) (33) | VAN PICKUP TRUCK UNKNOWN LIGHT TRUCK LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN) PICKUP TRUCK WITH CANOPY/SHELL COVER PICKUP TRUCK WITH SLIDE-IN CAMPER UNKNOWN TRUCK TYPE CHASSIS-MOUNTED CAMPER DELIVERY VAN (WALK-IN) | |
| HIGHEST POLICE INJURY SEVERITY CODE FOR THIS VEHICLE (0) O - NO INJURY (1) C - POSSIBLE INJURY | 55 | (35) (36) (37) (38) | STRAIGHT TRUCK TRUCK-TRACTOR (BOBTAIL) CHASSIS-CAB UNKNOWN HEAVY TRUCK TRACTOR & SEMI-TRAILER (SEMI) TRUCK (OR SEMI) & FULL TRAILER(S) | |
| (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT (7) NON-FATAL INJURY SEVERITY UNKNOWN (8) UNOCCUPIED VEHICLE | | (41) (42) (43) | UNKNOWN BUS TYPE SCHOOL BUS INTERCITY BUS (BETWEEN CITIES) TRANSIT BUS (INTRACITY) STREETCAR (ON TRACKS) | |
| (NOT APPLICABLE) (9) UNKNOWN | | (69) | TRAIN (CARS) LOCOMOTIVE (ENGINE, SWITCHER) UNKNOWN | |
| | | | LBASE <i>(cm)</i>) UNKNOWN | 58 |

| Duplicate columns 1-8 Module O V Format 0 2 from the previous card. | Отнег | R VEHICLE OV-2 |
|--|----------------------------|----------------|
| ORIGINAL SPEC | IFICATIONS | |
| Wheelbase cm | Front Overhang | cm |
| Curb Weight kg | Rear Overhang | cm |
| Average Track Width cm | Undeformed End Width (UEW) | cm |
| Overall Length cm | Engine Displacement | L |
| Overall Width (OAW) cm | Engine: # of Cylinders | 33 34 |
| VEHICLE D. | AMAGE | |
| | | |
| N/A | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| | | |
| FRONTAL CRAS | H OVERLAP | |
| Round up for .5. 98 = 98% or more Enter % overlap or "99" for missing or N/A. | Direct Damage Length (DDL) | cm |
| Front-End Overlap (Percent) = DDL UEW | | % 38 39 |

Vehicle Overlap (Percent) = DDL + 1/2 (OAW - UEW)
OAW

| Duplicate columns 1-8 Module V D Format C from the previous card. | 0 4 | | VEHICLE DESCRIPTION | VD-1 |
|---|-----------------------|--------|--|----------------------|
| MAKE: Land Rover | | | CARGO: NONE | |
| MODEL: Discovery IT | | | | |
| | | | | and the second |
| VIN SALTY L | ك ك | 15 | XA | |
| 12 ~ 9 1 | 1 (1 | | | 29 |
| MANUFAC/BODY CODE $\frac{4}{30}$ $\frac{58}{1}$ | $-\frac{7}{2}$ | STOLE | EN VEHICLE | |
| ١١ ڪَ | Ñ | (0) | | 8 |
| MAKE/MODEL CODE 2 1 1 | _ <u>~</u> | (1) | | 62 |
| 200 | <u>~</u> | | UNKNOWN | |
| MODEL YEAR $\Delta Q Q$ | $-\frac{\omega}{4^2}$ | | | |
| VEHICLE MASS (kg) D Q Q Q Q | 0 | BODY | STRUCTURE | , |
| ₩ | 48 | | BODY & FRAME | |
| ODOMETER (km) 8 8 8 8 | 8 | (2) l | JNITIZED NTEGRAL-STUB FRAME | 63 |
| (ENTER 8'S IF ELECTRONIC) 49 | 54 | (4) E | BODY & PLATFORM FRAME (E.G. VW BUG) | |
| NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) | 56 | (5) F | PARTIALLY UNITIZED OTHER: | |
| 99 | 9 | (9) t | JNKNOWN | |
| TRAVELING SPEED (km/h) | 59 | | | |
| (000) PARKED OR STOPPED (995) JUST STARTING UP | | TRANS | SMISSION | |
| (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) |) | (1) A | NONE AUTOMATIC | 64 |
| (998) SPEED EXCESSIVE <i>(BUT UNKNOWN)</i> (999) UNKNOWN | | | MANUAL JNKNOWN | |
| | | | | |
| VEHICLE TYPE | | LOCAT | TION OF TRANSMISSION | |
| PASSENGER VEHICLE (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR) | 22 | | TOR LEVER | |
| (12) 2-DOOR SEDAN OR COUPE (ANY UPPER B-PILLAR) | 60 61 | | FLOOR CONSOLE | \\ \\ \\ \\ \ |
| (13) 4-DOOR HARDTOP (14) 4-DOOR SEDAN | | (3) (| COLUMN DTHER: | 65 |
| (15) STATION WAGON (16) CONVERTIBLE | | | JNKNOWN | |
| (18) OTHER PASS. VEH. : | | | | |
| MULTIPURPOSE PASSENGER VEHICLE | | STEER | ING | |
| (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO) (22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN) | | (1) F | POWER | |
| (23) VAN, SIZE UNKNOWN (24) VAN, SMALL (MINI) | | | MANUAL JNKNOWN | 66 |
| (25) VAN, LARGE (29) MPV, TYPE UNKNOWN | | | | |
| (30) MOTOR HOME | | DD 414 | | |
| TRUCK (31) PICKUP TRUCK, UNKNOWN (32) PICKUP TRUCK, UNKNOWN | | BRAKE | | |
| (32) PICKUP TRUCK, SMALL (DOWNSIZED) (33) PICKUP TRUCK, LARGE | | (2) N | POWER MANUAL | 67 |
| (99) UNKNOWN | | (9) U | INKNOWN | |
| | | | | |

| | | VEHICLE DESCRIPTION VD-2 |
|---|----------|---|
| TYPE OF BRAKES (1) DRUM, ALL WHEELS (2) DISC, FRONT WHEELS (3) DISC, ALL WHEELS (9) UNKNOWN | 3 | WHEELBASE (cm) (999) Unknown |
| BRAKE ANTI-LOCK DEVICE (0) NONE INSTALLED (1) TWO-WHEEL (2) FOUR-WHEEL (7) EQUIPPED, UNKNOWN WHEELS (9) UNKNOWN AIR CONDITIONING IN VEHICLE | <u>2</u> | PLASTIC ANTI-LACERATIVE INNER LAYER GLASS EQUIPPED (0) NONE (1) WINDSHIELD (2) WINDSHIELD AND SIDE (7) OTHER (9) UNKNOWN |
| (0) NO (1) YES (8) NOT COLLECTED (9) UNKNOWN | 8 70 | (5) GINNIOWIN |
| TYPE OF DRIVE (1) REAR WHEEL (2) FRONT WHEEL (3) FOUR WHEEL (4) ALL WHEEL DRIVE (9) UNKNOWN | 3 | FIELD INVESTIGATOR INSTRUCTIONS: 1. INDICATE CRUSHED AREAS BY <u>OUT-LINING NEW PERIMETER</u> OF VEHICLE AND <u>SHADING THE DAMAGED AREAS</u> ON THE LARGE SKETCH ON PAGE VD-3. |
| DUAL REAR WHEELS (0) NO (1) YES (9) UNKNOWN | <u></u> | USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. 2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE |
| ORIGINAL TYPE OF RESTRAINT SYSTEM (1) ACTIVE BELT (2) PASSIVE BELT (3) AIRBAG (4) KNEE BOLSTERS (7) OTHER: (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | 3 | EXAMPLES BELOW AS A GUIDE. 3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR. 4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. EXAMPLES: |
| EQUIPPED WITH ROLL BAR (0) NO (1) YES (9) UNKNOWN | 74 | FRONT OR REAR |
| TYPE OF ROOF (0) NONE (1) SOLID (2) T-TOP CLOSED (3) T-TOP OPEN (4) SUN ROOF CLOSED (5) SUN ROOF OPEN (6) CONVERTIBLE CLOSED (7) CONVERTIBLE OPEN (8) OTHER: (9) UNKNOWN | 4 75 | ROOF (REFERENCE TO TOP OF DOOR SILL OR WINDOW SILL) |

Duplicate columns 1-8 from the previous card. VEHICLE DESCRIPTION

VD-3

ORIGINAL SPECIFICATIONS

254 cm Wheelbase

Front Overhang

Curb Weight

2080 kg

$$\frac{1}{13}$$
 5 5 cm

Front Overharing

Rear Overhang

Undeformed End Width (UEW)

The property of t


Average Track Width $\frac{1}{13} \frac{5}{5} \frac{5}{15}$ cm


Overall Length $\frac{4}{16} \frac{7}{8} \frac{1}{9} \frac{18}{21}$ cm


Overall Width (OAW) $\frac{1}{19} \frac{8}{9} \frac{9}{21}$ cm

Engine: # of Cylinders


VEHICLE DAMAGE

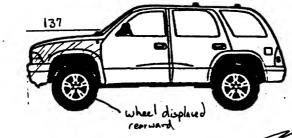

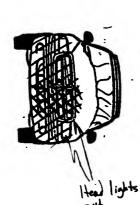

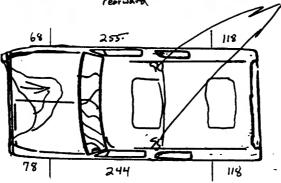



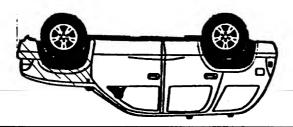

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more Enter % overlap or "99" for missing or N/A. Direct Damage Length (DDL)

 $\frac{\cancel{0}}{\cancel{35}} \frac{\cancel{4}}{\cancel{5}} \frac{\cancel{5}}{\cancel{57}} \text{ cm}$

Front-End Overlap (Percent) = DDL UEW

Vehicle Overlap (Percent) = DDL + 1/2 (OAW - UEW)
OAW

| Duplicate columns 1-8 Module D A from the previous card. 9 10 | Format <u>0 2</u> 11 12 | Damage DA-1 |
|---|--|--|
| PRIMARY | CASE VEHICLE PRIMARY CDC | CONTACTED VEHICLE ASSOCIATED CDC |
| EVENT NUMBER | 13 | |
| IMPACT SPEED (km/h) | <u>O</u> <u>6</u> <u>8</u> <u>16</u> | $\frac{998}{35}\frac{8}{36}$ |
| ESTIMATED BY | 17 | <u>⊗</u> 38 - |
| CRUSH (cm) | <u>Ø 6</u> 8 20 | $\frac{9}{39} \frac{9}{40} \frac{8}{41}$ |
| CDC #1 | 12.FYEW.3 | 98. <u>Ø</u> <u>Ø</u> <u>Ø</u> <u>Ø</u> . <u>Ø</u> |
| CDC #2 | $\underbrace{9}_{28} \underline{8} \underline{\mathcal{O}} \underline{\mathcal{O}} \underline{\mathcal{O}} \underline{\mathcal{O}} \underline{\mathcal{O}} \underline{\mathcal{O}}_{34}$ | $\frac{9}{49} \stackrel{\cancel{8}}{\cancel{8}} \cdot \stackrel{\cancel{\Phi}}{\cancel{\Phi}} \stackrel{\cancel{\Phi}}{\cancel{\Phi}} \stackrel{\cancel{\Phi}}{\cancel{\Phi}} \stackrel{\cancel{\Phi}}{\cancel{\Phi}} \stackrel{\cancel{\Phi}}{\cancel{\Phi}}$ |
| Duplicate columns 1-8 Module D A from the previous card. 9 10 | _Format <u>0 3</u> | |
| SECONDARY | CASE VEHICLE SECONDARY CDC | CONTACTED VEHICLE ASSOCIATED CDC |
| EVENT NUMBER | 8 ₁₃ | |
| IMPACT SPEED (km/h) | 14 15 16 | 35 36 37 |
| ESTIMATED BY | 17 | 38 |
| CRUSH (cm) | 18 19 20 | 39 40 41 |
| CDC #1 | 21 | 42 - 48 |
| CDC #2 | | 49 |
| Codes | | |
| EVENT NUMBER | IMPACT SPEED ESTIMATOR | CRUSH |
| (8) NOT APPLICABLE (9) UNKNOWN | (2) DRIVER (3) POLICE | (998) NOT APPLICABLE (NO VEHICLE/DAMAGE) (999) UNKNOWN |
| IMPACT SPEED (998) NOT APPLICABI | (4) "CRASH" PROGRAM (5) OTHER COMPUTER PROGRAM SPECIEV: | CDC |
| (999) UNKNOWN | _E SPECIFY: (7) OTHER: (8) NOT APPLICABLE (NO VEHICLE/NO IMPACT) | (9800000) NOT APPLICABLE (9900000) UNKNOWN |

| - | | | | |
|--|--|-------------------------------------|--|---|
| Duplicate columns 1-8 Mo from the previous card. | odule <u>D</u> <u>A</u> Format <u>0</u> <u>1</u> 12 | | DAMAGE DA-2 | |
| | MAXIMUM SHEE | T METAL CRUSH | | |
| | | 9) UNKNOWN | | |
| | (cm) (33) | of Oldarown | | |
| FRONT _ | <u>Ø 6 8</u> | RIGHT SIDE | Ø | |
| REAR (| 2 Q Q 2 1 | LEFT SIDE | \bigcirc \bigcirc \bigcirc \bigcirc \bigcirc | |
| ROOF (| $ \underbrace{\mathcal{D}}_{25} \mathbf{\Phi} \mathbf{\Phi}_{27} $ | OTHER | | |
| | | | | |
| | Chronologic | CAL SEQUENCE | | |
| | OF DAMAGE/INJURY PRO | DOUCING CRASH EVENTS | 3 | |
| | FOR CASE | E VEHICLE | | |
| | | | | |
| NOTE: IF CHRONOL | LOGICAL ORDER | DO YOU KNOW THI | STARIF 1 | |
| IS UNKNOW. ORDER IS O | N. EVENT | DO YOU KNOW THI TO BE IN CHRONOI | OGICAL ORDER? | |
| ONDEN 13 O | F HONAL. | (0) NO | 31 | |
| | | (1) YES | | |
| EVENT | INADACT LOCATION | IMPACT | OR IFOTA/FILIOI F | _ |
| EVENT NUMBER | IMPACT LOCATION | IMPACT CONFIGURATION | OBJECT/VEHICLE CONTACTED | |
| | (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE | FOR CODES, SEE TABLE | FOR CODES, SEE TABLE | |
| | (3) ON ROADSIDE (4) OUTSIDE ROADSIDE | ON PAGE DA-3. | ON PAGE DA-4. | |
| | RIGHT-OF-WAY (5) OTHER | | | |
| | (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN | | | |
| | 7 | 17 | 77 | |
| # 1 | 32 | - 34 | 1 1 36 | |
| #2 | | 34 | 3.0 | |
| π 2 | 37 | 39 | 41 | |
| #3 | 42 | | - | |
| | 76 | 44 | *** | |
| #4 | | | | |

#5

#6

#7

57

62

CODES FOR IMPACT CONFIGURATION

FRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND <u>FRONT</u> OF CONTACTED VEHICLE (TYPE T) (22) AND <u>FRONT</u> OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T) (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND <u>UNKNOWN</u> OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDÉSWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

(99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- NO OBJECT (00)
- (01) (39) PASSENGER VEHICLE & TRUCK
- (40) (69) OTHER VEHICLE
- (70) (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) (97) OFF-ROADWAY OBJECT
- OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE

WHEELBASE

| SUB-MINI | < 2286 mm (< 90") |
|--------------|--------------------------------|
| MINI | 2286 - 2412 mm (90" - 94.9") |
| SUB-COMPACT | 2413 - 2539 mm (95" - 99.9") |
| COMPACT | 2540 - 2666 mm (100" - 104.9") |
| INTERMEDIATE | 2667 - 2793 mm (105" - 109.9") |
| FULL | 2794 - 2920 mm (110" - 114.9") |
| LARGE | 2921 - 3174 mm (115" - 124.9") |
| LIMOUSINE | > 3175 mm (> 125°) |

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107". E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107°, E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

Bus

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 75 cc
- (52) 76 125 cc
- (53) 126 250 cc
- (54) 251 500 cc
- (55) 501 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Roven Roven

| Duplicate columns 1-8 Module <u>C</u> R from the previous card. | Format <u>0</u> <u>1</u> | _ | H RECONSTRUCT | TION CR-1 |
|--|---|---|------------------|----------------------|
| | CASE VEHICLE P | RIMARY IMPACT | CASE VEHICLE SEC | CONDARY IMPACT |
| | CASE VEHICLE | CONTACTED VEHICLE | CASE VEHICLE | CONTACTED VEHICLE |
| EVENT NUMBER | 13 | | 47 | |
| _ ΔV (km/h) TOTAL | <u>D</u> 4 8 16 | 8 8 9 3 3 3 3 4 | 48 49 50 | 66 67 68 |
| LONGITUDINAL* | $\frac{-047}{17}$ | $\frac{8}{35} \frac{8}{3} \frac{8}{38}$ | 51 54 | 69 72 |
| LATERAL* | $\frac{+}{21}$ $\bigcirc \bigcirc \bigcirc$ | 888 39 42 | 55 58 | 73 - 76 |
| *NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN. | | | | |
| EXAMPLES: 10 km/h = ± <u>Q 1 0</u> -7 km/h = <u>: Q Q 7</u> | | | | |
| ENERGY DISSIPATED BY CRUSH (ki) | $\frac{\Phi}{25} \frac{1}{198917} \frac{9}{28}$ | 888 | 59 62 | 77 80 |
| RECONSTRUCTION | , 15 | | | |
| (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL | <u>2</u> <u>2</u> | | 63 64 | |
| (21) RECONSTRUCTED, LOW CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL | 29 30 | | 33 33 | |
| NOT RECONSTRUCTED BECAUSE | | | | |
| (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE (04) ROLLOVER (05) VAULTING (06) OTHER TRAVEL IN MORE THAN ONE PLANE (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE (09) YIELDING OBJECT (10) OTHER: (11) AT LEAST ONE VEHICLE BEYOND SCOPE (12) OTHER VEHICLE NOT INSPECTED | | | | |
| MODE | | | | |
| (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC (4) TRAJECTORY & CDC & DETAILED DAMAGE (5) NOT RECONSTRUCTED | 31 | | 65 | |
| COMPUTER PROGRAM SPECIFY: WINSMASH | | | | |

| Duplicate columns 1-8 Module C R Format 0 2 for EBS CRASH RECONSTRUCTION CR-2 for EBS | | | | | | | |
|--|---|---|------------------------------|----------------------|--|--|--|
| | CASE VEHICLE P | RIMARY IMPACT | CASE VEHICLE SECONDARY IMPAC | | | | |
| | CASE VEHICLE | CONTACTED VEHICLE | CASE VEHICLE | CONTACTED VEHICLE | | | |
| EVENT NUMBER | 13 | | 47 | | | | |
| EBS (km/h) TOTAL | 14 15 16 | 888 32 33 34 | 48 49 50 | 66 67 68 | | | |
| LONGITUDINAL* | $\frac{}{} \otimes 4 \frac{7}{20}$ | 8888 35 | 51 54 | 69 72 | | | |
| LATERAL* *NOTE: THESE EBS COMPONENTS | $\frac{1}{21}$ \mathcal{Q} \mathcal{Q} $\frac{8}{24}$ | $\frac{8}{39} \frac{88}{8} \frac{8}{8}$ | 55 58 | 73 76 | | | |
| MUST INCLUDE SIGN. EXAMPLES: $10 \text{ km/h} = \pm 0.1.0$ $-7 \text{ km/h} = \pm 0.0.7$ | | | | | | | |
| ENERGY DISSIPATED BY CRUSH (kj) | <u>Ø</u> 199 | 8 8 8 8 | 59 62 | 77 — 80 | | | |
| RECONSTRUCTION | | | | | | | |
| (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL | 22 | | | | | | |
| (21) RECONSTRUCTED, LOW CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL | 29 30 | | 63 64 | | | | |
| NOT RECONSTRUCTED BECAUSE | | | | | | | |
| (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE (04) ROLLOVER (05) VAULTING | | | | | | | |
| (06) OTHER TRAVEL IN MORE THAN ONE PLANE (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE (09) YIELDING OBJECT (10) OTHER: (11) AT LEAST ONE VEHICLE BEYOND SCOPE (12) OTHER VEHICLE NOT INSPECTED | | | | | | | |
| MODE | | | | | | | |
| (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC (4) TRAJECTORY & CDC & DETAILED DAMAGE (5) NOT RECONSTRUCTED | $\frac{2}{31}$ | | 65 | | | | |

COMPUTER PROGRAM SPECIFY:____

Duplicate columns 1-8 from the previous card.

Module <u>C</u> <u>R</u> Format <u>0</u> <u>3</u>

CRASH RECONSTRUCTION

CR-3

NOTES:

- 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
- 2. MEASURE C $_1$ TO C $_6$ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.


CASE VEHICLE

LOCATOR

- 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
- 4. USE THE CENTER OF THE WHEELBASE AS THE CG.

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

| Specific Impact No. | Location of Direct Damage | Location of Field L |
|---------------------|--|---------------------|
| | Begins +50 cm from O Front bumper corner | B.C. to B.C. |
| | | |

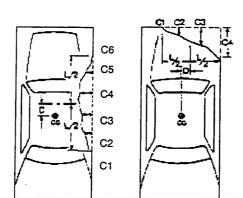

DL <u>45</u>

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other_
- (9) Unknown

CRUSH PROFILE IN CENTIMETERS

| | NOTE: Each | line in the tal | | separate re | cord (card) | . Du | plicate col | lumns 1 - 1 | 2 for each | complete | d line. |
|------------------------------|---------------------------------|---------------------------|------------------------|-------------|----------------|----------------|----------------|----------------|----------------|----------------|-------------|
| Specific Impact Number | Plane of Impact C-Measur. | Direct Length (DDL) | Damage Max Crush | Field | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| | Bumper | 45 | C4 | 118 | 21 | 40 | 69 | 71 | 34 | 20 | -14 |
| | String the ad | <u> </u> | | | - 3 | -3 | -3 | -3 | -3 | -3 | |
| | | | | | 18 | 37 | 66 | 68 | 31 | 17 | |
| | | | | | | | | | | | |
| 1 | | 045 | 068 | 118 | 018 | <i>0</i> 37 | 066 | 068 | 031 | 017 | -014 |
| 13 | 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | 0 | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 2 | | | | | | | | | | | |

Duplicate columns 1-8 from the previous card.

Module <u>C</u> <u>R</u> Format <u>0</u> <u>4</u> 12

CRASH RECONSTRUCTION

CR-4

NOTES:

- 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN <u>CENTIMETERS</u>.
- 2. MEASURE C $_{\rm 1}$ TO C $_{\rm 6}$ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

OTHER VEHICLE


LOCATOR

- 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
- 4. USE THE CENTER OF THE WHEELBASE AS THE CG.

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

| Specific Impact No. | Location of Direct Damage | Location of Field L |
|---------------------|---------------------------|---------------------|
| | | |
| | | |
| | | |

N/A

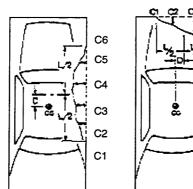

DL _____

UDL ____

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

CRUSH PROFILE IN CENTIMETERS

| | NOTE: Each | line in the tab | le below is a | separate rec | ord (card). | | | umns 1 - 1 | 2 for each | complete | d line. |
|------------------------------|---------------------------------|---------------------------|------------------------|--------------|----------------|----------------|----------------|----------------|----------------|----------------|-------------|
| Specific Impact Number | Plane of Impact C-Measur. | Direct Length (DDL) | Damage Max Crush | Field L | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| | | - | | | | | | | | | |
| - | | | | | | | | | | | |
| | | | | | | | | | | | |
| 1 | | | | | | | | | | | |
| 13 | . 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | 30 31 32 | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 2 | | | | | | | | | | | |

| Duplicate columns 1-8 Module W T Format from the previous card. | 0 <u>1</u> | WHEELS AND TIRES WT-1 |
|---|------------|--|
| WHEELSDAMAGED LF (0) NO RF (1) YES (9) UNKNOWN RF | | SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S) LF 25565R16XP RF 25565R16XP RR 25565R16XP LR 25565R16XP |
| TIRE TREAD TYPE (1) REGULAR (2) SNOW (3) SLICKS (4) ALL WEATHER (MS) (7) OTHER: RF (9) UNKNOWN LR | 4 4 | |
| CARCASS CONSTRUCTION LF (1) BIAS (2) BELTED BIAS (3) RADIAL (4) ELLIPTICAL (5) HI PRESSURE SPARE (6) SPACE SAVER SPARE (7) OTHER: (9) UNKNOWN LR | 3 3 | |
| IF VEHICLE IS EQUIPPED WITH DUAL WHEELS, COMPLETE FOR OUTER WHEELS AND MAKE NOTES ON INNER WHEELS. NOTES: | | |

| - Du plicate columns 1-8 Module <u>F</u> <u>T</u> Format <u>C</u> from the previous card. 9 10 11 | | FUEL AND FUEL TANKS | FT-1 |
|--|-----|---|-----------------|
| TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: (9) UNKNOWN | 13 | AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | 21 |
| MAIN TANK LOCATION | 122 | AUXILIARY TANK LOCATION | <u>\$88</u> |
| MAIN FILLER CAP LOCATION | 133 | AUXILIARY FILLER CAP LOCATION | 88 25 27 |
| MAIN TANK MATERIAL | 3 | AUXILIARY TANK MATERIAL | <u>8</u> 28 |
| | | | |

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8 from the previous card.

Module F L Format 0 1 12

FUEL LEAKAGE

FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.



| | I | . 11 | 111 | IV | V | |
|----------------|----------------------|---------------------|-------------------|-----------------------|---------------------|-----------------|
| LEAK NUMBER | LEAKING COMPONENT | COMPONENT SOURCE | TYPE OF DAMAGE | SEVERITY OF DAMAGE | LOCATION OF LEAK | EVENT NUMBER |
| #1 | 14 15 | - 1 | | | | 21 |
| #2 | 22 23 | | / I - | _ | | 29 |
| #3 | 30 31 | | 11 - | | | 37 |
| #4 | 38 39 | | | | _ | 45 |
| #5 | 46 47 | | | | 4 | 53 |

LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT (LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT (LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

| Fuplicate columns 1-8 from the previous card. Module F R Format 0 11 | | FIRE | FR-1 |
|---|-----|--|------|
| WAS THERE FIRE IN (0) NO <u>SKIP</u> PAG (1) YES <u>COMPLE</u> | BE. | CASE VEHICLE? | |
| DID FIRE START IN CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 14 | SEVERITY OF FIRE DAMAGE (1) MINOR (2) MODERATE (3) SEVERE (9) UNKNOWN | 16 |
| FLAME PROPOGATION RATE (1) RAPID/EXPLOSIVE (2) SLOW/MODERATE (9) UNKNOWN | 15 | DID AN INJURY TO CASE VEHICLE OCCUPANT RESULT FROM FIRE IN OR ON CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 17 |

PROVIDE NOTES IF FIRE OCCURRED.

| Duplicate columns 1-8 Module E D Format 0 from the previous card. 9 10 11 | EXTERIOR DAMAGE | D-1 |
|--|--|-----------------------------|
| HOOD PERFORMANCE FOR THE FOLLOWING, USE CODES: | STEERING COL FLEXIBLE COUPLING FLEXIBLE COUPLING TYPE (0) NONE | 0 |
| (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | (1) FLEXIBLE MATERIAL (2) POT (3) SINGLE U-JOINT (4) DOUBLE U-JOINT (5) FLEXIBLE CABLE (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OTHER: | <u>9</u> ₂₆ |
| HOOD LATCH <i>(ES)-</i> -RELEASED | (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN, IF EQUIPPED | |
| -DAMAGED | L COUPLINGDAMAGED | 9 |
| -JAMMED | (USE CODES 15 FROM <u>HOOD</u> PERFORMANCE) -SEPARATED (COMPLETE) | 9 28 |
| HOOD HINGESLEFT, DAMAGED | 16 | |
| -LEFT, SEPARATED (COMPLETE) | 17 | |
| -RIGHT, DAMAGED | Eng Compart Telescoping Unit | |
| -RIGHT, SEPARATED (COMPLETE) | TYPE OF UNIT (00) NONE INSTALLED (01) - (07) SEE UNITS ON PAGE ED-2 (88) NOT COLLECTED (97) OTHER: | $\frac{8}{29} \frac{8}{30}$ |
| HOOD REMAINED ON VEHICLE | (98) EQUIPPED, TYPE UNKNOWN (99) UNKNOWN IF EQUIPPED | |
| REAR EDGE OF HOODELEVATED | ORIGINAL LENGTH (mm) | |
| -CONTACTED WINDSHIELD | F (OR H): | |
| -PENETRATED WINDSHIELD | TELESCOPED LENGTH (mm) G: | |
| HOOD LATCH LOCATION | | |
| (1) FRONT OF VEHICLE (2) COWL AREA (3) SIDE (8) NOT APPLICABLE (9) UNKNOWN | DIFFERENCE (mm) F (OR H) - G (IF LESS THAN 15mm, ENTER *000*.) (888) NOT COLLECTED | |
| Engine or Transmission Mount separation (complete) (0) NO (1) YES (9) UNKNOWN | (991) NOT MEASUREDING | 8 8 8 3 |

| | | Exterior Damage | E | ED-2 |
|---|------------------|--|-----------------|-----------|
| LEFT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | <u>Ø</u> 34 | LEFT DOORS HOW DID DOORS OPEN DURING COLLISION? USE CODES: | | |
| LEFT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN -A-PILLAR, UPPER | 4 | (0) DOOR DID NOT OPEN OPENED BECAUSE OF (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | | |
| LOWER -B-PILLAR, UPPER | ₫ | | -FRONT -REAR | Ø 43 Ø 44 |
| LOWER -C-PILLAR, UPPER | Ø Ø | DOORS JAMMED CLOSED- USE CODES: (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | | |
| LOWER | 39 <u>4</u> 0 | | -FRONT | 45 |
| -D-PILLAR, UPPER LOWER | 41 41 42 | | | |
| | | | | |


| | | Exterior Damage | ED-3 |
|---|---------|--|-------------|
| | | OTHER REAR DAMAGE | |
| REAR DOOR REAR DOOR TYPE (0) NO DOOR (INCLUDES PICKUPS) (1) HATCHBACK (2) ONE-WAY TAILGATE (3) TWO-WAY TAILGATE (4) CLAMSHELL/DISAPPEARING | 5 47 | WAS PARTITION TO LUGGAGE AREA DAMAGED DURING COLLISION? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | S 50 |
| TAILGATE (5) SINGLE DOOR (6) DOUBLE DOOR (9) UNKNOWN Hatchback One-way | | SPARE TIRE (0) NO SPARE TIRE (1) NOT ATTACHED BEFORE COLLISION (2) ATTACHED, NOT SEPARATED IN COLLISION (3) ATTACHED, SEPARATED DUE TO COLLISION (8) NOT COLLECTED (9) UNKNOWN | 8 51 |
| Two-way Clamshell Single door Double door | | TRAILER HITCH TYPE (0) NO HITCH BALL-AND-SOCKET TYPES (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON) (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK) (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING) (4) LOAD EQUALIZING OTHER TYPES | 52 |
| HOW DID DOOR OPEN DURING COLLISION? (0) DOOR DID NOT OPEN OPENED BECAUSE OF | <u></u> | (5) RING-AND-PINTLE (6) FIFTH-WHEEL (INCL. P/U) (7) OTHER (E.G. CLEVIS-AND-PIN) (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN IF EQUIPPED | |
| (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | | TRAILER TYPE (AT TIME OF COLLISION) (0) NO TRAILER (1) TRAVEL-TRAILER/CAMPER (2) MOBILE HOME (3) BOAT/SNOWMOBILE/ATV TRAILER (4) UTILITY TRAILER (5) TOWED CAR (7) OTHER: (8) TRAILER, TYPE UNKNOWN (9) UNKNOWN | <u></u> |
| DOOR JAMMED CLOSED (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | 49 | | |

| | | Exterior Damage E | ED-4 |
|--|---------------------------------------|--|-----------------------|
| RIGHT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | Ø 54 | RIGHT DOORS HOW DID DOORS OPEN DURING COLLISION? USE CODES: | |
| RIGHT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | (00) DOOR DID NOT OPEN OPENED BECAUSE OF (01) HINGE AREA SEPARATION (02) DOOR-LATCH SEPARATION (03) LATCH-STRIKER SEPARATION (04) STRIKER-PILLAR SEPARATION (05) BODY DISTORTION (06) COMBINATION OF ABOVE (CIRCLE EACH) (07) OPENED, REASON UNKNOWN (11) VAN RIGHT-REAR DOOR OPENED (ANY MECHANISM) | |
| -A-PILLAR, UPPER | ₽ 55 | (98) NOT APPLICABLE <i>(NO DOOR)</i> (99) UNKNOWN -FRONT | 00 |
| LOWER | <u>Ø</u> | -PRONT | 63 64 Ø Ø 65 66 |
| -B-PILLAR, UPPER | ₽ 57 | DOORS JAMMED CLOSED- | 65 66 |
| LOWER | <u></u> | USE CODES: | |
| -C-PILLAR, UPPER | D 59 | (1) YES (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | |
| LOWER | $ \underbrace{\phi}_{\overline{60}} $ | -FRONT -REAR | 67 |
| -D-PILLAR, UPPER | <u></u> | | 68 |
| LOWER | Q e₂ | VAN REAR DOOR TYPE (0) VAN, NO REAR DOOR (1) TRACK (SLIDING) - RIGHT SIDE (2) SINGLE-HINGED - RIGHT SIDE (3) DOUBLE-HINGED - RIGHT SIDE (4) TRACK (SLIDING) - RIGHT & LEFT SIDE (5) SINGLE-HINGED - RIGHT & LEFT SIDE (6) DOUBLE-HINGED - RIGHT & LEFT SIDE (7) TRACK AND HINGED COMBINATION (8) NOT APPLICABLE (NOT A VAN) (9) UNKNOWN | 8 69 |

EXTERIOR DAMAGE ED-5 WINDSHIELD DAMAGE WINDSHIELD MARK ON CASE VEHICLE: LAND D WINDSHIELD CRACKED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN PILKINGTON WINDSHIELD BROKEN OPTIKOOL (PLASTIC INTERLAYER TORN) LAMINATED (1) YES (8) NOT APPLICABLE (9) UNKNOWN CRACKED OR BROKEN BY OCCUPANT CONTACT (0) NO (1) YES (8) NOT APPLICABLE WINDSHIELD CODE (9) UNKNOWN (97) DESCRIBED BUT NOT CODED (98) NOT APPLICABLE (NO WINDSHIELD) **EXTENT OF BOND SEPARATION** (99) UNKNOWN (0) NONE Roof (1) 1 - 20% (2) 21 - 40 DID T-ROOF/SUN ROOF OPEN DURING COLLISION? (3) 41 - 60 (4) 61 - 80 (5) 81 - 99 (6) TOTAL (0) NO (7) SEPARATED, AMOUNT (1) YES UNKNOWN (8) NOT APPLICABLE (8) NOT APPLICABLE (NOT A T-ROOF OR SUN ROOF) (9) UNKNOWN

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

(9) UNKNOWN

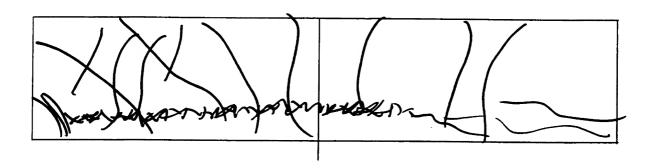

| Duplicate columns 1-8 from the previous card. Module S C Format 0 11 | | STEERING WHEEL AND COLUMN | SC-1 |
|--|----------|--|------|
| STEERING WHEEL STEERING WHEEL RIM DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT | <u>✓</u> | STEERING WHEEL POSITION AT TIME OF COLLISION IN WHAT O'CLOCK POSITION WAS THE NORMAL TOP OF THE WHEEL POINTED WHEN THE COLLISION OCCURRED? EXAMPLES | |
| (3) BROKEN (9) UNKNOWN NUMBER OF STEERING WHEEL SPOKES | | O'CLOCK = 1 2 | |
| STEERING WHEEL SPOKES (9) UNKNOWN | 4 | (NORMAL STRAIGHT AHEAD) O'CLOCK = | |
| STEERING WHL SPOKE DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT (3) BROKEN (9) UNKNOWN | 15 | STEERING WHEEL ENERGY ABSORBING DEVICE (1) EXAMPLES: BARRACUDA, 70 - 74 CHALLENGER, 70 - 74 CAPRI, 71 - 77 | |
| STEERING COLUMN OPTIONS | | (2) EXAMPLES: OMNI, 78 - HORIZON, 78 - | |
| TILT FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED, UNK POSITION (2) UP (3) MIDDLE (4) LOWER (9) UNKNOWN IF EQUIPPED | 2 16 | TYPE OF DEVICE (0) NONE (1) CONVOLUTED OR MESH CYLINDER (2) DEEP DISH STEERING WHEEL (7) OTHER: (8) NOT COLLECTED (9) UNKNOWN IF EQUIPPED ORIGINAL DIMENSION (mm) | 8 19 |
| SWING-AWAY FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | P | A: DAMAGE DIMENSION (mm) B: DIFFERENCE (mm) | |
| TELESCOPING FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | 18 | A - B (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO MEASURE (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 |

| | | STEERING WHEEL AND COLUMN | SC-2 |
|---|--|--|---------|
| STEERING COLUMN | | STEERING WHEEL (CONTINUED) | |
| ENERGY ABSORBING DEVICE | | | |
| TYPE OF DEVICE * (IF 27 OR 28) | | STEERING WHEEL HUB DAMAGE | |
| (00) NOT EQUIPPED (88) NOT COLLECTED (99) UNKNOWN | 8 8 24 | (0) NONE (1) OCCUPANT CONTACT (2) AIRBAG | <u></u> |
| ORIGINAL LENGTH (mm) | | (3) OTHER (9) UNKNOWN | |
| C: | | | |
| COMPRESSED LENGTH (mm) D: | | | |
| BRACKET DEFLECTION (IF CODE 36, 48, OR 49 ABOVE) | | | |
| COMPRESSION (OR EXTRUSION) (mm) | | | |
| C - D (OR E) (TOLERANCE: ±10) | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | $\frac{8}{25} \frac{8}{27} \frac{8}{27}$ | | |
| * (ADD A & B FOR TOTAL COMPRESSION) | | | |
| SHEAR CAPSULE SEPARATION (mm) | | | |
| S (USE AVG. OF LEFT & RIGHT CAPSULES.) | | | |
| RT: | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT SEPARATION (992) SEPARATED, AMOUNT UNKNOWN (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 30 | | |
| COLUMN VERTICAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) UPWARD APPARENT ROTATION (2) DOWNWARD APPARENT ROTATION (9) UNKNOWN | <u>a</u> | | |
| COLUMN LATERAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) LEFT APPARENT ROTATION (2) RIGHT APPARENT ROTATION (9) UNKNOWN | 32 | | |

| | | | | | Intrusion | N IT-1 |
|----------------------|---------|----------------------------------|-----------------------------|----------------------------|--|--|
| Location Intrusio | of n | Intruded | Component | Compari Value | (All Measurements Are in Centimeters) son Intruded Value = Intrusion | Dominant Crush Direction |
| 11 Toe pan | | | an | 61 | -47 = 14 | cernard |
| | | | | | - = | |
| | | | | | | |
| | | | | | - = | |
| | | | | | - = | |
| - | | | | , | _ <u>=</u> | |
| | | | | | _ = | |
| | | | | | _ = | |
| | | | | | - = | |
| | | | | | - = | |
| | | | | | _ <u>=</u> | |
| | | | | | = | |
| | | | | | _ <u>=</u> | |
| | | | | | _ <u>=</u> | |
| | | | | | _ = | |
| | | | | | _ = | |
| | | | 0 | CCUPANT C | CONTACT WORKSHEET | 1 |
| Contact | Co | Interior emponent ontacted | Occupant No. if Known | Body Region if Known | Supporting Physical Evidence | Confidence Level of Contact Point |
| Α | Kne | e bolster | 1 | Knee | scuff mark | 1 |
| В | Kne | e bolster | 1 | knee | visible dent | 1 |
| С | I | . console | 1 | thigh | cracked | |
| D | ł | I.P. | 1 | Chest | coin bin displaced | 2 |
| E | 1 | vant | 1 | Chest | Coin bin displaced Knob displaced | 2 |
| F | | | | | • | |
| G | | | | | | |
| Н | | | | | | |
| ı | | | | | | |
| J | | | | | | |

Cracked

INTRUSION IT-3

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

| (1) | LEFT | (3) RIC | GHT | ••••• | | ••••• | ••••• | ••••• | INDIVIDU | JAL SEAT |
|-----|-----------------|---------|------------|-------|----------------------|-------|--------|-------|----------|-------------------------|
| (1) | LEFT | (2) CE | NTER | (3) | RIGHT | •••• | | | BENCH: | FULL WIDTH 3 PASSENGER |
| (1) | LEFT | (2) LEI | FT NTER | | RIGHT CENTER | (3) | RIGHT | | BENCH: | FULL WIDTH 4 PASSENGER |
| (1) | LEFT | (2) CE | NTER | (5) | RIGHT & AISLE SPA | CE | ••••• | | BENCH: | PARTIAL WIDTH, LEFT |
| | LEFT & SPACE | (2) CE | NTER | (5) | RIGHT & SPACE | •••• | •••••• | | BENCH: | PARTIAL WIDTH, CENTERED |
| (4) | ENTIRE V | /EHICLE | E WIDTH | | | | | | CARGO | AREA |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR 5 PASSENGERS

VAN 12 PASSENGER CAPACITY

| X | | | X | 11 | | | 13 | |
|---|---|---|---|----|----|----|----|----|
| X | X | X | | | | 21 | 22 | 25 |
| x | X | X | | | | 31 | 32 | 35 |
| X | X | X | X | 41 | 42 | 46 | 43 | |

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
- (Y) Y-AXIS (LATERAL)
- (Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

| OCCUPANT | INJURY | • |
|----------|--------------|---|
| NUMBER | NUMBER | CONTACT |
| (00) | (00) | NO CONTACT |
| (##) | (00) | CONTACT, NO INJURY |
| (97) | (99) | CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN |
| (99) | (00) OR (99) | UNKNOWN IF CONTACT |
| | | |

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

(01) INSTRUMENT PANEL

(02) FIRE WALL

(03) TOE PAN

(04) FLOOR PAN

(05) STEERING COLUMN

(06) WINDSHIELD

(07) WINDSHIELD HEADER

(08) A-PILLAR

(09) DOOR PANEL OR SIDE PANEL

(10) WINDOW FRAME

(11) B-PILLAR

(12) C-PILLAR

(13) D-PILLAR

(14) ROOF SIDE RAILS

(15) ROOF OR CONVERTIBLE TOP

(16) BACKLIGHT HEADER

(17) FRONT SEAT-BACK SURFACE/ SEAT-BACK BACK SURFACE

(18) SECOND SEAT-BACK SURFACE SEAT-BACK BACK SURFACE

(19) THIRD SEAT-BACK SURFACE

SEAT-BACK BACK SURFACE
(20) FOURTH SEAT-BACK SURFACE

SEAT-BACK BACK SURFACE
(21) FIFTH SEAT-BACK SURFACE

SEAT-BACK BACK SURFACE
(22) BACK PANEL/BACK DOOR SURFACE

(23) SEAT CUSHION SURFACE/EDGE

(24) CONSOLE

(25) OTHER (DESCRIBE)

(26) UNKNOWN INTERNAL SURFACES

(28) TRANSMISSION TUNNEL (HUMP)

(29) SIDE FOOTWELL PANEL (KICKPANEL)

(30) SILL

EXTERNAL

(43) HOOD

(44) OBJECT EXTERNAL TO PASSENGER COMPARTMENT BUT PART OF CASE VEHICLE

(45) OUTSIDE SURFACE OF CASE VEHICLE

(46) OTHER (E.G. SPARE TIRE, JACK. DESCRIBE.)

(49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF ALL THESE COMPONENTS INTRUDED INTO A SINGLE OCCUPANT SPACE.

(50)WINDSHIELD HEADER A-PILLAR

ROOF SIDE RAIL

(51)INSTRUMENT PANEL A-PILLAR DOOR PANEL

(52)INSTRUMENT PANEL A-PILLAR WINDSHIELD HEADER

(53)DOOR PANEL B-PILLAR ROOF RAIL

(54)DOOR PANEL A-PILLAR ROOF RAIL

(55)INSTRUMENT PANEL FLOOR PAN A-PILLAR DOOR FRAME

(56)ROOF RAIL A-PILLAR B-PILLAR WINDOW FRAME

(57)ROOF RAIL A-PILLAR B-PILLAR C-PILLAR DOOR PANEL

(58)ROOF ROOF RAIL WINDOW FRAME DOOR PANEL

(59)BACKLIGHT HEADER ROOF C-PILLAR THIRD SEAT-BACK (60)ROOF
ROOF RAIL
A-PILLAR
B-PILLAR
C-PILLAR
WINDOW FRAME
DOOR PANEL
FLOOR PAN

(61)INSTRUMENT PANEL TOE PAN WINDSHIELD HEADER A-PILLAR ROOF RAIL WINDOW FRAME DOOR PANEL ROOF

(62)ROOF
ROOF RAIL
C-PILLAR
WINDOW FRAME
FLOOR PAN
SECOND SEAT
DOOR PANEL

(63)ROOF RAIL
ROOF
B-PILLAR
WINDOW FRAME
FLOOR PAN
DOOR PANEL
SECOND SEAT
FRONT SEAT

(64)ROOF RAIL
ROOF OR CONVERTIBLE TOP
A-PILLAR
B-PILLAR
WINDOW FRAME
WINDOW HEADER

(65)WINDSHIELD WINDSHIELD HEADER ROOF SIDE RAIL

(66)WINDSHIELD WINDSHIELD HEADER A-PILLAR

(98)NOT APPLICABLE

(99)UNKNOWN

| Duplicate columns 1-8 Module from the previous card. | <u>I</u> <u>T</u> Format <u>0</u> <u>1</u> 12 | | | Inte | RUSION | IT-5 |
|---|--|--|---|-----------------------|---|-----------------------|
| WAS THERE OCCUPANT COM (0) NO <u>DO NOT</u> ANSWER NEX (1) YES <u>ANSWER</u> NEXT QUEST (9) UNKNOWN <u>SKIP PAGE</u> . | T QUESTION. <u>SKIP PAGE</u> . | 13 W | (0) NO (1) YES | COMPLETE PA | | 14 |
| Duplicate columns 1-8 Module from the previous card. NOTE: Each line in the table below | $\frac{1}{9} \frac{T}{10} \text{Format } \underbrace{0}_{11} \underbrace{2}_{12}$ is a separate record (card). Du | plicate columns | s 1 - 12 for each | n completed li | ne. | |
| CODES F | TRUSIONS IN THIS ORDER: LE FOR B, F, G, H, I, J ON PAGE FOR C ON PAGE IT-4 | | | ONT TO BACI | | S. |
| A B C INTRUDING INTRUSION OCC. COMPONENT NUMBER SPACE NO. OR OBJECT | D E F ASSOC. MAXIMUM MAXIMUM EVENT INTRUSION INTRUSION NO. X AXIS (cm) Y AXIS (cm) | | H OCCUPANT NUMBER | I INJURY NUMBER | J OCCUPANT NUMBER | K INJURY NUMBER |
| 13-14 15-16 17-18 | 19 20-21 22-23 | 24-25 | 26-27 | 28-29 | 30-31 | 32-33 |
| 0 1 11 03 | 1 14 00 | ΦΦ | 00 | 00 | 00 | 00 |
| 0 2 | | | | | | |
| 0 7 NOTE: USE ADDITIONAL PAGE IF MORE TH | AN 7 INTRUSIONS. | | | | | |
| Duplicate columns 1-8 Module from the previous card. | <u>I T</u> Format <u>0 3</u> 9 10 11 12 | | | | | |
| NOTE: IF NO SIDE DOOR INTRUSION, SKIP REMAINDER OF PAGE. SIDE DOOR INTRUSION RESULTED FROM | | DOOR CO SION, CODE DAMAGED DMPONENT 1 | MPONENT I COMPONE DAMAG COMPON | NT GED IENT 2 | CODES | |
| INTRUSION NUMBER CAUSE CODES FOR CAUSE: | A | | 25 29 33 | - ((- ((| O) NONE 1) A-PILLAR 2) B-PILLAR 3) C-PILLAR 4) LATCH/STRI 5) HINGES 7) OTHER: | KER |
| | 34 35 | | 37 | . (| 9) UNKNOWN | |

Duplicate columns 1-8 from the previous card.

INTRUSION

IT-6

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.

CODES FOR B, F, G, H, I, J ON PAGE IT-3

CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

| A INTRUSION NUMBER | B OCC. SPACE NO. | C INTRUDING COMPONENT OR OBJECT | | E MAXIMUM INTRUSION X AXIS (cm) | F MAXIMUM INTRUSION Y AXIS (cm) | G MAXIMUM INTRUSION Z AXIS (cm) | H OCCUPANT NUMBER | I INJURY NUMBER | J OCCUPANT NUMBER | K INJURY NUMBER |
|--------------------|------------------------|--|----|--|--|--|-------------------------|-----------------------|-------------------------|-----------------------|
| 13-14 | 15-16 | 17-18 | 19 | 20-21 | 22-23 | 24-25 | 26-27 | 28-29 | 30-31 | 32-33 |
| 0 8 | | | | | | | | | | |
| <u>0</u> 9 | | | | | | | | | | |
| 10 | | | | | | | | | | |
| 11 | | | | | | | | | | |
| <u>1</u> 2 | | | | | | | | | | |
| <u>1</u> <u>3</u> | | | | | | | | | | |
| 1 4 | | | | | | | | | | |
| <u>1</u> <u>5</u> | | | | | | | | | | |
| <u>1 6</u> | | | _ | | | | —— | | | |
| 1 7 | | | _ | | | | | | | |
| <u>1</u> 8 | | | _ | | — | | | | | |
| <u>1</u> 9 | | | _ | | | | | | | |
| 2 0 | | | _ | | | | | | , | |
| 2 1 | | | | | | | | | | |
| 22 | | | _ | | | | | | | |
| 2 3 | | | _ | | | | | | | |
| 2 4 | | | | | | | | | | |
| 2 5 | | | | | | | | | | |
| | | | | | | | | | | |


| SIDES FRONT DOOR FRONT HARDWARE FRONT ARMREST FRONT GLASS FRONT GL | ule <u>I</u> <u>D</u> Format <u>0</u> <u>1</u> 9 10 11 12 | INTERIOR DAMAGE ID-1 |
|--|---|---|
| SIDES FRONT DOOR FRONT HARDWARE FRONT ARMREST FRONT GLASS REAR DOOR AREA REAR HARDWARE REAR ARMREST REAR GLASS ROOF SIDE RAIL B-PILLAR C-PILLAR D-PILLAR | 0) NO 1) YES 3) NO, and OCCUPANT CONTACT | (4) YES, and OCCUPANT CONTACT (8) NOT APPLICABLE (9) UNKNOWN |
| T-ROOF/SUN ROOF | FRONT FOOT CONTROLS IGNITION KEYS IGNITION KEYS REAR VIEW MIRROR SUNVISOR/FITTINGS (5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES WINDSHIELD TOP MOLDINGS LEFT A-PILLAR (UPPER OR LOWER) RIGHT A-PILLAR (UPPER OR LOWER) CENTER CONSOLE TRANSMISSION SELECTOR LEVER RIM, HORN, SPOKE PAGE 140 141 151 162 173 185 185 185 185 185 185 185 185 185 185 | INSTRUMENT PANEL UPPER PANEL UPPER PANEL 46 UPPER PANEL 47 48 LOWER PANEL 48 CONTROL KNOBS & LEVERS GLOVE COMPARTMENT AREA 49 INSTRUMENTS PARKING BRAKE RELEASE PARKING BRAKE PEDAL A/C OR UPPER VENT OUTLETS 44 DESTRUMENTS FARMING FARMING |
| OTHER: * 2 n d Sun 100 f | 42 44 | REAR WINDOW WINDOW HEADER CONSOLES VERTICAL ROOF ROOF |

^{*} MORE THAN ONE ITEM MAY BE NOTED.

| | Duplicate columns 1-8 Module S T from the previous card. | | 2 12 | SEATS | | ST-1 |
|---|---|-------------|-------------------|---|----------|-----------------------|
| | FRONT SEAT TYPE OF FRONT SEAT | DRIVER | Passen'r | FRONT SEAT-BACK | DRIVER | Passen'r |
| - | (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE | 5 13 14 | <u>D</u> <u>5</u> | SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 3/30 | 31 |
| | (97) OTHER: | 17 | 18 | SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 3 32 | 3 3 3 |
| | SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 19 | 20 | LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 34 | 35 |
| | ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 21 | 22 | RECLINER MECHANISM HELD (0) NO | 1 | 37 |
| | CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | <u>8</u> | <u>B</u> | (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 36 | 37 |
| | FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> 25 | <u>D</u> 26 | HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: (8) NOT APPLICABLE | 38 | 39 |
| | CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED | 2 | 7 | (9) UNKNOWN REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 40 | Q ₄ |
| | FRONT SEAT ROTATION (0) NONE APPARENT | 2 | Ф | ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN | 42 | 43 |
| | (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY (8) NOT APPLICABLE (9) UNKNOWN | 28 | 29 | HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN | <u>Q</u> | 45 |

| - | | | Se | ATS S | ST-2 |
|---|----------|------------|--|----------------------|--------------------------|
| FRONT SEAT ADJUSTMENT | DRIVER | PASSEN'R | SECOND SEAT (CONT.) | | |
| SEAT ADJUSTMENT TYPE (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN ADJUSTMENT PROVIDED (1) 2-WAY | 3 | 3 | (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED | 6 | 0 |
| (2) 4-WAY (3) 6-WAY (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 48 | 49 | SECOND SEAT-BACK LOCKS | LEFT | Rіgнт |
| SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 50 | 51 | FOR THE FOLLOWING, USE: (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | | 0 |
| SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN | 52 | <u></u> 53 | LEFT OR CENTER, EQUIPPED LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN RIGHT, EQUIPPED | 61 63 63 | 8 8 64 1 66 |
| PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN | <u>Z</u> | 3 55 | RIGHT, HELD (3) SEAT FOLDED DOWN THIRD SEAT | 65 67 | 68 |
| SECOND SEAT | LEFT | Right | EQUIPPED | Q | $ \Phi_{\overline{70}} $ |
| TYPE OF SECOND SEAT (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT | 2 56 | <u>Z</u> | BACKREST DAMAGED CUSHION DAMAGED | 89 71 80 73 | 70 8 72 72 74 |
| (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN | <u></u> | 59 | VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN Applies to any rear-seat position | 7 | 5 |

| Duplicate columns 1-8 from the previous card. Module A B Format 0 11 | | AIRBAG A | AB-1 |
|--|----|---|-------------|
| DRIVER SIDE LOCATION OF AIRBAG STEERING WHEEL EQUIPPED (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED DEPLOYED (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 13 | PASSENGER SIDE LOCATION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) EQUIPPED (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED DEPLOYED (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 16 |
| CONDITION OF AIRBAG STEERING WHEEL (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPEDNOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | 15 | CONDITION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPEDNOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | 1 |
| DRIVER SIDE AIRBAG STEERING WHEEL TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | 19 | PASSENGER SIDE AIRBAG INSTRUMENT PANEL (GLOVE BOX) TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | <u></u> |
| MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 20 | MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | <u></u> |

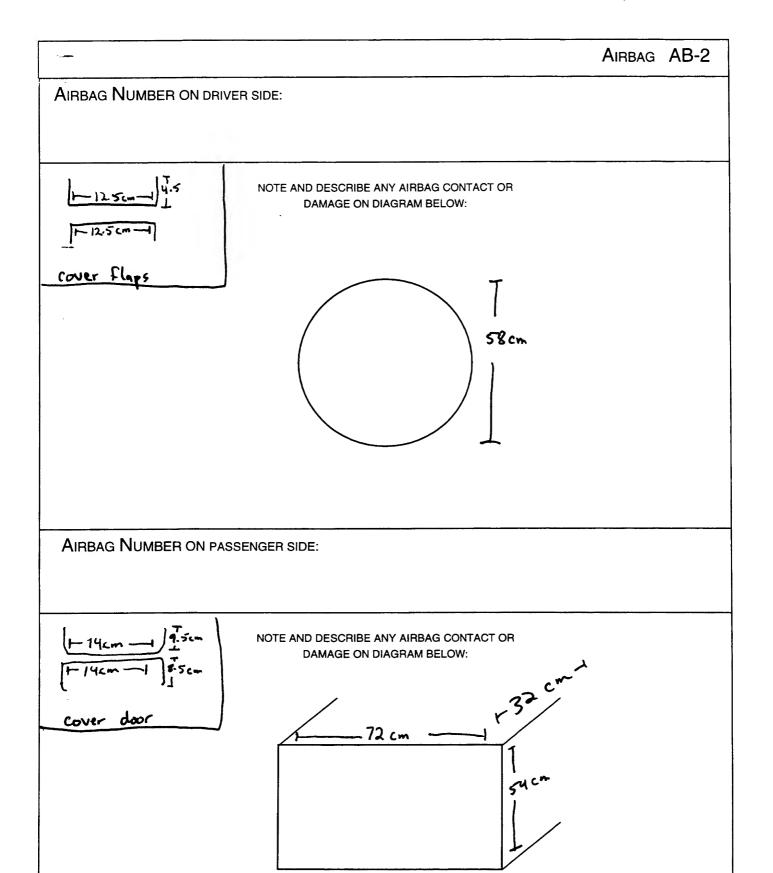

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,

OCCUPANT INFORMATION AND INJURY CLASSIFICATION,

ARE TO BE FILLED IN

FOR EACH CASE VEHICLE OCCUPANT,

WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.


| Duplicate columns 1-8 from the previous card. Module O C Format 0 11 | |
|---|---|
| OCCUPANT IDENTIFICATION OCCUPANT NUMBER ROLE OF OCCUPANT AT 1ST IMPACT (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN MASS (kg) |
| OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN | (999) UNKNOWN HEIGHT (cm) (999) UNKNOWN SEX (1) MALE (2) FEMALE (9) UNKNOWN |
| LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN | MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS |
| POSTURE (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR | (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN INJURY SEVERITY SCORE (ISS) (99) UNKNOWN NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) |
| (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: (99) UNKNOWN | (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN |


| | | OCCUPANT INFORMATION | OC-2 |
|---|---------|--|-------|
| MEDICAL CONDITIONS (CONT.) POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN | <u></u> | CHILD SEAT TYPE (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL | 88 |
| ACTIVE RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN ACTIVE RESTRAINT SYSTEM USAGE (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIRBAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: (9) UNKNOWN PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIRBAG NOT DEPLOYED (2) AIRBAG DEPLOYED | 3/37 | EJECTION (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, RIGHT SIDE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED | 9 4 4 |
| (3) AIRBAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN | 40 | HEAD RESTRAINT HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN | 46 |

| | | Occupant Information | OC-3 |
|--|----------|---|------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | <u>Q</u> | SOURCE OF INFORMATION (0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN | 48 |

OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

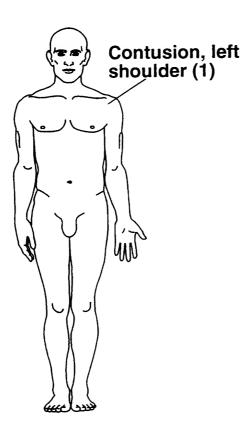

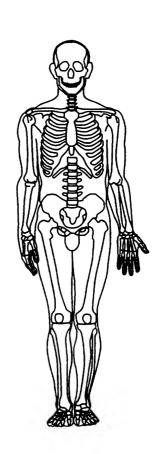

Duplicate columns 1-8 from the previous card.

Module 1
9

Injury Classification IC-1

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

| | | | | | PRIMARY OIC | | | ASSOCIATED OIC | | | | | COMMENTS | | |
|--|---------------|-------------------------------|---|--|---------------|----------|----------|----------------|-------------|---------------|----------|-------------|----------------|-------------|--|
| OCCUPANT NUMBER | INJURY NUMBER | PROBAE START V IN 1ST C | BILITY (HORI WITH MOST CONTACT AF | N ORDER OF IZONTALLY) . PROBABLE REA COLUMN. ILE CONTACT | BODY REGION 1 | ASPECT Q | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY 15 | BODY REGION 1 | ASPECT O | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY 15 | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | |
| Q_{I} | <u> </u> | 34 | | | <u>S</u> | L | <u>C</u> | Ī | 1 | | | _ | | | |
| | | | | | - | _ | _ | _ | | _ | | | | _ | |
| | | | | | _ | _ | _ | | _ | | | | _ | | |
| | | | | | _ | _ | _ | _ | _ | _ | | | | | |
| | | | | | _ | _ | _ | _ | _ | _ | _ | | _ | | |
| | | | | | - | _ | | | _ | _ | | | | | |
| | | | | | - | _ | | _ | _ | | _ | | | | |
| line. — | | | | | - | _ | | _ | | | | | | _ | |
| for each | | | | | - | _ | _ | | _ | _ | | _ | | | |
| Number | | | | | _ | _ | _ | | _ | | _ | _ | _ | | |
| ccupant | | | | | _ | _ | | | _ | _ | | _ | _ | | |
| Duplicate "Occupant Number" for each line. | | | | | _ | | | | _ | | | | | | |
| ng | | | | | _ | | | | _ | _ | | | | | |
| | | | | | _ | _ | _ | _ | | _ | _ | | _ | | |
| | | | | | - | _ | | | _ | | _ | | | - | |
| | | | | | | _ | | | | _ | | | _ | | |
| | | | | | _ | _ | | | | | _ | | | | |
| | | | | | | | | _ | | | | | | | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

| FRONT (| OF PASSENGER COMPARTMENT | SIDES | |
|--------------|--|---------|---|
| (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING | (20) | SURFACE OF SIDE INTERIOR |
| (12) | WINDSHIELD | (19) | HARDWARE ON SIDE OR DOOR |
| | | (13) | ARMREST ON SIDE OR DOOR |
| (05) | INSTRUMENT PANEL (SPECIFIC AREA UNKNOWN) | (24) | COAT HOOK |
| (54) | UPPER INSTRUMENT PANEL (X) | | |
| (55) | MIDDLE INSTRUMENT PANEL (Y) | (22) | WINDOW GLASS (SIDE) |
| (56) | LOWER INSTRUMENT PANEL (Z) | (21) | WINDOW FRAMES (SIDE) |
| (81) | ASH TRAY (INSTRUMENT PANEL) | | |
| (02) | GLOVE COMPARTMENT AREA | (26) | ROOF SIDE RAIL |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (14) | A-PILLAR |
| | | (15) | B-PILLAR |
| (57) | BENEATH INSTRUMENT PANEL | (16) | C-PILLAR |
| (53) | PARCEL TRAY | (17) | D-PILLAR |
| (48) | KNEE RESTRAINT | | |
| (86) | VERTICAL CONSOLE | FLOOR | |
| ,, | | (40) | FLOOR |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (27) | CONSOLE ON FLOOR OR BETWEEN SEATS |
| (/ | , | (44) | TRANSMISSION LEVER ON FLOOR OR CONSOLE |
| (09) | STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | (85) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE |
| (65) | STEERING WHEEL | (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) |
| (66) | STEERING WHEEL COLUMN | (91) | |
| (59) | TRANSMISSION LEVER ON COLUMN | (/ | |
| (33) | TIANGING CONTROL CONTR | Roof | |
| (03) | HARDWARE ITEM (SPECIFIC AREA UNKNOWN) | (25) | ROOF OR CONVERTIBLE TOP |
| | INSTRUMENT(S) | (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING |
| (82) (83) | CONTROL KNOB(S) & LEVER(S) (FRONT) | (26) | ROOF SIDE RAIL |
| | PARKING BRAKE HANDLE IN FRONT | (24) | COAT HOOK |
| (84) | | (18) | DOME LIGHT |
| (67) | IGNITION KEY | (39) | BACKLIGHT HEADER |
| (06) | MIRROR HEATER OR AIR CONDITIONING DUCTS | (68) | |
| (04) | | (69) | |
| (01) | AIR CONDITIONING OR VENTILATION OUTLET(S) | (03) | NOLL BAN |
| (80) | RADIO (BUILT IN) | EVTERIO | OR SURFACE OF CASE VEHICLE |
| (58) | ADD-ON TAPE DECK, RADIO, A/C | | OUTSIDE SURFACE OF CASE VEHICLE |
| (68) | ROOF MOUNTED CONTROLS/CONSOLES | ` ' | (SPECIFIC AREA UNKNOWN) |
| REAR | | (35) | HOOD OF CASE VEHICLE |
| (88) | SURFACE OF REAR INTERIOR | (60) | EXTERIOR OF CASE VEHICLE (E.G. |
| (23) | REAR WINDOW | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (39) | REAR WINDOW HEADER | (62) | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| (50) | REAR SEAT CUSHION & BACK | (63) | TRUNK LID OF CASE VEHICLE |
| | | (64) | TIRES OF CASE VEHICLE |
| | R-GENERAL | _ | • W |
| (11) | TRANSMISSION SELECTION LEVER (LOCATION UNK.) | | CASE VEHICLE BOUNDARY |
| (59) | TRANSMISSION LEVER ON STEERING COLUMN | (36) | AREA EXTERIOR TO CAR (SPECIFIC AREA UNK.) |
| (44) | TRANSMISSION LEVER ON FLOOR OR CONSOLE | (70) | HOOD OF OTHER VEHICLE |
| (07) | PARKING BRAKE HANDLE (LOCATION UNKNOWN) | (71) | OTHER VEHICLE EXTERIOR HARDWARE (E.G. |
| (84) | PARKING BRAKE HANDLE IN FRONT | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (85) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE | (73) | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (74) | HEADLIGHT OR FRONT GRILL OF OTHER VEH. |
| \—- <i>,</i> | | (75) | TRUNK OF OTHER VEHICLE |
| (29) | FRONT SEAT-BACK(S) | (76) | OUTSIDE SURFACE OF OTHER VEHICLE |
| | FRONT SEAT CUSHION | (77) | TIRES OF OTHER VEHICLE |
| (50) | | (78) | GROUND |
| | ARMREST ON SEAT | (79) | WATER |
| (89) | | (80) | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| (03) | | (, | OR WATER. PLEASE DESCRIBE.) |
| (33) | RESTRAINT SYSTEM HARDWARE | _ | 0 |
| (34) | RESTRAINT SYSTEM WEBBING | | ATING OBJECTS |
| (87) | AIR CUSHION SKIN (AIRBAG) | (61) | OTHER VEHICLE |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (72) | OBJECTS (DESCRIBE) |
| (46) | AIRBAG GAS | | |
| (48) | KNEE RESTRAINT | MISCELL | ANEOUS |
| (30) | | | NO CONTACT (INVALID FIELD FORM CODE) |
| (42) | | (38) | OTHER (E.G. FIRE. DESCRIBE) |
| (43) | - · · · · | (90) | SPARE TIRE |
| (31) | | (96) | |
| (32) | OTHER OCCUPANT(S) | (97) | |
| (52) | INTERNAL FLYING GLASS (FROM ANY SOURCE) | (98) | |
| (41) | | ζ/ | HYPEREXTENSION/COMPRESSION |
| (-1) | | (99) | |
| | | , , , | |

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

- (H) HEAD/SKULL
- (F) FACE
- (N) NECK
- (S) SHOULDER
- (X) UPPER EXTREMITIES
- (A) ARM (UPPER)
- (E) ELBOW
- (R) FOREARM
- (W) WRIST/HAND
- (C) CHEST
- (M) ABDOMEN
- (B) BACK
- (P) PELVIC/HIP
- (Y) LOWER EXTREMITIES
- (T) THIGH
- (K) KNEE
- (L) LEG (LOWER)
- (Q) ANKLE/FOOT
- (O) WHOLE BODY
- (U) UNKNOWN

3 LESION

- (L) LACERATION
- (C) CONTUSION
- (A) ABRASION
- (F) FRACTURE
- (P) PERFORATION, PUNCTURE
- (K) CONCUSSION
- (V) AVULSION
- (R) RUPTURE
- (S) SPRAIN
- (D) DISLOCATION
- (N) CRUSH
- (M) AMPUTATION
- (B) BURN
- (G) DETACHMENT, SEPARATION
- (Z) FRACTURE AND DISLOCATION
- (T) STRAIN
- (E) TOTAL SEVERANCE, TRANSECTION
- (O) OTHER
- (U) UNKNOWN

4 SYSTEM/ORGAN

- (S) SKELETAL
- (V) VERTEBRAE
- (J) JOINTS
- (D) DIGESTIVE
- (L) LIVER
- (N) NERVOUS SYSTEM
- (B) BRAIN
- (C) SPINAL CORD
- (E) EARS
- (O) EYES
- (A) ARTERIES
- (H) HEART
- (Q) SPLEEN
- (G) UROGENITAL
- (K) KIDNEYS
- (R) RESPIRATORY
- (P) PULMONARY/LUNGS
- (M) MUSCLES
- (T) THYROID, OTHER ENDOCRINE GLAND
- (I) INTEGUMENTARY (SKIN)
- (W) ALL SYSTEMS IN REGION
- (U) UNKNOWN

2 ASPECT

- (R) RIGHT
- (L) LEFT
- (B) BILATERAL
- (C) CENTRAL
- (A) ANTERIOR/FRONT
- (P) POSTERIOR/BACK
- (S) SUPERIOR/UPPER
- (I) INFERIOR/LOWER
- (W) WHOLE REGION
- (U) UNKNOWN

SEVERITY 5 SYSTEM/ORGAN 4 LESION 3 ASPECT Q BODY REGION 1

5 SEVERITY (OR "AIS", ABBREVIATED INJURY SCALE)


- (0) NONE
- (1) MINOR
- (2) MODERATE
- (3) SERIOUS
- (4) SEVERE
- (5) CRITICAL
- (6) MAXIMUM
- (9) UNKNOWN

| Duplicate columns 1-8 from the previous card. Module O C Format 0 11 | | Occupant Information | OC-1 |
|--|--|--|---|
| OCCUPANT IDENTIFICATION OCCUPANT NUMBER ROLE OF OCCUPANT AT 1ST IMPACT (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | $ \frac{Q}{13} \frac{2}{14} $ $ \frac{2}{15} $ | PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN | 29 25 |
| OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN | 16 | MASS (kg) (999) UNKNOWN HEIGHT (cm) (999) UNKNOWN SEX (1) MALE (2) FEMALE (9) UNKNOWN | $ \begin{array}{c c} 06 \\ \hline 24 & 25 \\ \hline 16 \\ \hline 27 & 28 \\ \hline 30 \end{array} $ |
| LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN | 5 17 | MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA | <u>Ø</u> 31 |
| POSTURE (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD SEAT (80) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: | 18 19 | (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN INJURY SEVERITY SCORE (ISS) (99) UNKNOWN NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH NON-FATAL INJURY (7) OTHER: (8) COMBINATION OF ABOVE (CIRCLE EACH) | $\frac{\cancel{O}}{33}$ $\frac{\cancel{O}}{35}$ |

| | | Occupant Information | OC-2 |
|--|----------|--|----------|
| MEDICAL CONDITIONS (CONT.) POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT | | CHILD SEAT TYPE (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van | 8 8 |
| (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN | 2 ** | (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL | |
| RESTRAINT SYSTEM | | | |
| ACTIVE RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN | 3 | EJECTION DEGREE OF EJECTION (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED | <u>Ø</u> |
| ACTIVE RESTRAINT SYSTEM USAGE (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN | 38 | AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, REAR OR TAILGATE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR | 98 45 |
| PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIR BAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS | <u>/</u> | FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED | |
| (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIR BAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: (9) UNKNOWN | 39 | IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW: | |
| PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIR BAG NOT DEPLOYED (2) AIR BAG DEPLOYED (3) AIR BAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED | 2 | | |
| (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN | | HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN | 46 |

| | | OCCUPANT INFORMATION | OC-3 |
|--|----|---|------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | 47 | SOURCE OF INFORMATION (0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN | 7 48 |

INDICATE LOCATION OF INJURIES.

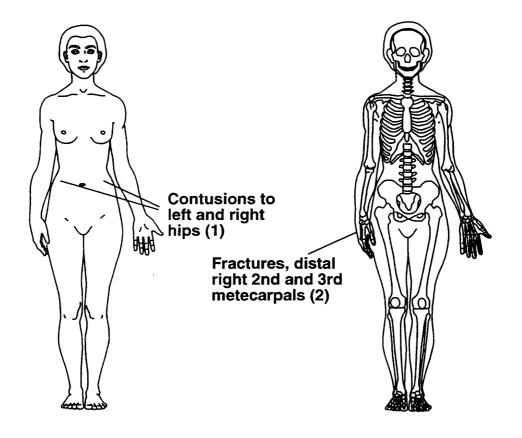

Duplicate columns 1-8 from the previous card.

Module 1 C Format 0 1 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

| | | | | | | PRIM | IARY (| OIC | | A | ssoc | IATE | OIC | | COMMENTS |
|----------------------------------|---------------|-------------------------------|--|--|---------------|----------|-----------|----------------|-------------|---------------|----------|-------------|----------------|-------------|----------|
| OCCUPANT NUMBER | INJURY NUMBER | PROBAL START V IN 1ST C | BILITY (HOR WITH MOST CONTACT AI | IN ORDER OF IZONTALLY). PROBABLE REA COLUMN. BLE CONTACT | BODY REGION 1 | ASPECT Q | CESION 3 | SYSTEM/ORGAN 4 | SEVERITY 15 | BODY REGION 1 | ASPECT Q | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY 15 | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | |
| <u> </u> | <u>Q1</u> | 34 | | | P | _ | C | I | 1 | _ | | _ | | _ | |
| 1 | @ | 34 | | | P | <u>R</u> | \bar{C} | Ī | 1 | _ | | _ | _ | _ | |
| | 03 | 20 | | | w | R | F | 5 | 2 | | | | | | |
| | 04 | 20 | | | N | R | F | <u>S</u> | <u>2</u> | | _ | | _ | _ | |
| | 21 | 22 | | | - | <u> </u> | <u>-</u> | <u>v</u> | | _ | _ | _ | - | _ | |
| | | —— | | | - | | | _ | _ | _ | | _ | _ | - | |
| | | | | | - | _ | _ | _ | _ | _ | | _ | | - | |
| | | | | | _ | _ | _ | _ | _ | _ | _ | _ | _ | _ | |
| | | | | | _ | _ | _ | | | _ | _ | _ | _ | _ | |
| "Occupant Number" for each line. | | | | | | | _ | | | | | | | | |
| er" for e | | | | | | | | | | | | | | | |
| t Numb | | | | | _ | _ | _ | _ | | _ | | | | | |
| ccupan | | | | | | | _ | _ | | _ | _ | _ | _ | - | |
| | | | | | _ | | | | - | - | | | _ | - | |
| - Duplicate | | | | | _ | _ | _ | | _ | _ | _ | . — | _ | _ | |
| | | | | | _ | | | _ | _ | | | | | _ | |
| | | | | | _ | _ | | | | | | | | | |
| | | | | | | | _ | _ | | | | | _ | _ | |
| | | | | | | _ | _ | | _ | _ | | | | - | |
| | | | | | | _ | | _ | | | _ | _ | | | |
| | | | | | | _ | _ | _ | | _ | | | _ | _ | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

| | OF PASSENGER COMPARTMENT | SIDES | |
|---------------------|---|---------|---|
| (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING | (20) | SURFACE OF SIDE INTERIOR |
| (12 |) WINDSHIELD | (19) | |
| • | | · · | |
| (05 | INCTOLIMENT DANIEL (CRECIEIO AREA LINICALOMA) | (13) | |
| | • | (24) | COAT HOOK |
| (54) | UPPER INSTRUMENT PANEL (X) | | |
| (55) | MIDDLE INSTRUMENT PANEL (Y) | (22) | WINDOW GLASS (SIDE) |
| (56) | LOWER INSTRUMENT PANEL (Z) | (21) | |
| (81) | ' ' | (21) | WINDOW FRAMES (SIDE) |
| | • | | |
| ~ ~ (02) | - : | (26) | ROOF SIDE RAIL |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (14) | A-PILLAR |
| | | • • • | B-PILLAR |
| (57) | BENEATH INSTRUMENT PANEL | | |
| | | (16) | C-PILLAR |
| (53) | | (17) | D-PILLAR |
| (48) | KNEE RESTRAINT | | |
| (86) | VERTICAL CONSOLE | FLOOR | |
| | | | El 000 |
| (20) | FOOT CONTROLS (INCL. DADICING PRICE OFFI | | FLOOR |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (27) | CONSOLE ON FLOOR OR BETWEEN SEATS |
| | | (44) | |
| (09) | STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE |
| (65) | | (00) | FOOT CONTROL O WHILE ON PLOUR OR CONSULE |
| | | | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) |
| (66) | | (91) | KICKPANEL |
| (59) | TRANSMISSION LEVER ON COLUMN | | |
| | | Roof | |
| (03) | HARDWARE ITEM (SPECIFIC AREA UNKNOWN) | | POOF OR COMPERTING F |
| (82) | | (25) | |
| | | (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING |
| (83) | CONTROL KNOB(S) & LEVER(S) (FRONT) | (26) | |
| (84) | PARKING BRAKE HANDLE IN FRONT | (24) | • |
| (67) | IGNITION KEY | | |
| (06) | | (18) | |
| | | (39) | |
| (04) | | (68) | ROOF MOUNTED CONTROLS/CONSOLE |
| (01) | AIR CONDITIONING OR VENTILATION OUTLET(S) | (69) | ROLL BAR |
| (08) | | (55) | HOLL DAIL |
| (58) | | F | Currier Currier |
| | | EXTERIO | OR SURFACE OF CASE VEHICLE |
| (68) | ROOF MOUNTED CONTROLS/CONSOLES | (37) | OUTSIDE SURFACE OF CASE VEHICLE |
| | | ` ' | (SPECIFIC AREA UNKNOWN) |
| REAR | | (OE) | |
| | SURFACE OF REAR INTERIOR | (35) | HOOD OF CASE VEHICLE |
| | | (60) | EXTERIOR OF CASE VEHICLE (E.G. |
| | REAR WINDOW | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (39) | REAR WINDOW HEADER | (62) | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| (50) | REAR SEAT CUSHION & BACK | (63) | TRUNK UP OF CASE VEHICLE |
| | | | TRUNK LID OF CASE VEHICLE |
| larence. | PR-GENERAL | (64) | TIRES OF CASE VEHICLE |
| | | | |
| (11) | TRANSMISSION SELECTION LEVER (LOCATION UNK.) | BEYOND | CASE VEHICLE BOUNDARY |
| (59) | TRANSMISSION LEVER ON STEERING COLUMN | (36) | AREA EXTERIOR TO CAR (SPECIFIC AREA UNK.) |
| (44) | | (50) | |
| | BARKING BRAKE HANDLE / COATION AND CONSOLE | (70) | HOOD OF OTHER VEHICLE |
| | PARKING BRAKE HANDLE (LOCATION UNKNOWN) | (71) | OTHER VEHICLE EXTERIOR HARDWARE (E.G. |
| (84) | PARKING BRAKE HANDLE IN FRONT | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (85) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE | (73) | EXTERIOR SIDE POOF DAIL OF OTHER VEHICLE |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| () | TOTAL PERSON OF THE PERSON OF | (74) | HEADLIGHT OR FRONT GRILL OF OTHER VEH. |
| (00) | EDONIT CEAT PACK(C) | (75) | TRUNK OF OTHER VEHICLE |
| (29) | FRONT SEAT-BACK(S) | (76) | OUTSIDE SURFACE OF OTHER VEHICLE |
| (51) | FRONT SEAT CUSHION | (77) | TIRES OF OTHER VEHICLE |
| (50) | REAR SEAT CUSHION & BACK | | |
| | ARMREST ON SEAT | (78) | GROUND |
| | | (79) | WATER |
| (89) | UNDER SEAT BOTTOM | (80) | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| | | , - • | OR WATER. PLEASE DESCRIBE.) |
| (33) | RESTRAINT SYSTEM HARDWARE | | TITLE I LEAGE DESCRIBE.) |
| | RESTRAINT SYSTEM WEBBING | Devices | |
| | | | ATING OBJECTS |
| | AIR CUSHION SKIN (AIRBAG) | (61) | OTHER VEHICLE |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (72) | OBJECTS (DESCRIBE) |
| (46) | AIRBAG GAS | \· =/ | / |
| (48) | KNEE RESTRAINT | Moore | ANICOLIO |
| (30) | HEAD RESTRAINT | MISCELL | |
| | | (00) | |
| (42) | | (38) | OTHER (E.G. FIRE. DESCRIBE) |
| (43) | CHILD SEAT | | SPARE TIRE |
| (31) | INTERIOR LOOSE OBJECT | | |
| (32) | OTHER OCCUPANT(S) | (96) | INDUCED |
| | | (97) | EJECTED, UNKNOWN CONTACT |
| (52) | INTERNAL FLYING GLASS (FROM ANY SOURCE) | (98) | IMPACT FORCE, "WHIPLASH". |
| (41) | UNKNOWN INTERIOR SURFACE | ` ' | HYPEREXTENSION/COMPRESSION |
| | | /nn\ | |
| | | (99) | UNKNOWN AREA OF CONTACT |









N 16100



I16100#5





N 16100#













PN 16100#1

















et Availat





et Availabl



















16100#3



N 161002



110100#2













6100 ≇44





16100#42









141 30 6 15 2000 Land Street 71 Concrete CO SUI (Shown) 30-year shift make the second second







might have players all female
(1975 pe) All ag (full les
(per el bett work prinsp exprépted
2 5

